



# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



## **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.3.3

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 2 for corrective action.

Costs and Funding \_

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed 

In Progress 

Not Complete 

As of

Βv

Status Not Complete As of 05/09/2013

DBB

6/30/2031

Reported By

**Classification** 

**Planned Completion** 

Implementation
Plan Nbr:

Priority:

Keynote 2

Palos Verdes Dr. West & Hawthorne

Location:



—Field Condition

Photo #

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

**Other** 2005 PROWAG-R306.2

DOJ Location Type:

Use: PV Severity: C

Level of Difficulty

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2.400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

DBB

Moderate

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Ву \_\_\_\_

Location: Photo #
Palos Verdes Dr. West & Hawthorne





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds



Location:	Photo #
Palos Vardas Dr. Wast & Hawthorna	1

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

- Implementation Plan Nbr:

Completed □ In Progress □ Not Complete □ As of

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

By .

DBB

Reported By

Priority:

**Keynote** 

Blvd.



Location: Palos Verdes Dr. West & Hawthorne Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable

039 - Operable Parts - Miscellaneous - See Additional Comments

part(s) of pedestrian signal device exceeds 5 lbs.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 2 for corrective action.

Additional Comments: Provide audible signal device.

Existing Condition: 6 LBF.

Corrective Action

1991 ADAAG 4.27.4

2004 ADAAG 3094

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

Costs and Funding

**Funding Received** 

Qty ...Of: 1 EA

**Total Cost** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Ву



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

Field Condition

Existing Condition: 1/2" diameter.

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Additional Comments: See Keynote 6 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2031 Status Not Complete As of 05/09/2013

DBB

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

**Keynote** 

Palos Verdes Dr. West & Hawthorne

Location:

Field Condition

Photo #

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

**Existing Condition:** 

Corrective Action

1991 ADAAG -2004 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

Βv

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Reported By

Location: Photo # Palos Verdes Dr. West & Hawthorne





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

**Keynote** 



Reporting: 112 of 4367 Rcds

Location: Photo # Palos Verdes Dr. West & Hawthorne

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Βv

**Keynote** 



Location: Photo # Palos Verdes Dr. West & Hawthorne

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments: Relocate curb ramp.

Existing Condition: 7.1% CS.

**Corrective Action** 

1991 ADAAG 4.2.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 **Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

30 SF

\$4.176

Вν





## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

Field Condition

Existing Condition: 1/2" diameter.

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 10 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

6/30/2031

DBB

Reported By

**Classification** 

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

Palos Verdes Dr. West & Hawthorne

10

Location:

**Keynote** 

Field Condition

Photo #

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

Βv

PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

**Existing Condition:** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Ву



Location: Photo # Palos Verdes Dr. West & Hawthorne





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

11

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 

Status Not Complete As of 05/09/2013

6/30/2026

DBB

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

Βv

**Keynote** 12

Palos Verdes Dr. West & Hawthorne

Location:

Blvd.



Field Condition

Photo #

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: Stable floor surface is not provided.

1991 ADAAG 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

**DOJ Location Type:** PV Use: Severity: Level of Difficulty Hiah

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

Qty ...Of: 30 SF

**Total Cost** \$576

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Вν

Location: Photo # Palos Verdes Dr. West & Hawthorne 12

App: ©2010 BOA Architecture 877-225-4ADA

Page 6 of 56



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 



Reporting: 112 of 4367 Rcds

13

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 14 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

**Keynote** 14

Palos Verdes Dr. West & Hawthorne

Location:



Field Condition

Photo #

13

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

**Total Cost** 

Other 2005 PROWAG-R306.2

1 EA

\$2,400

**DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Palos Verdes Dr. West & Hawthorne Blvd.

13

039 - Operable Parts - Miscellaneous - See Additional Comments Qty ...Of:

Additional Comments: Replace with vibrotactile signal device.

**Funding Received** \$0

Status Update (check one) Completed □ In Progress □ Not Complete □ As of

Ву





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Moderate

Keynote 15



Reporting: 112 of 4367 Rcds

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2

DOJ Location Type: 1

Use: PV
Severity: A

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Photo #

13

Palos Verdes Dr. West & Hawthorne

Blvd.

Location:

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$2.400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Classification

\_\_\_\_\_ By \_

Keynote 16



—Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 5.9% slope.

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306.2.1

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty High

-Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

**Funding Received** 

**Qty ...Of**: 30 SF

Total Cost \$576

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Вν

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #
Palos Verdes Dr. West & Hawthorne 16



# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

17

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

**Classification** 

Implementation
Plan Nbr:

Priority:

Keynote 18

Palos Verdes Dr. West & Hawthorne

Location:

18

Photo #

17

17

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

2004 ADAAG -

2007 CBC

Costs and Funding

Qty ...Of:

**Total Cost** 

1991 ADAAG -

**Other** 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV Severity: C

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Palos Verdes Dr. West & Hawthorne

Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

Keported b

As of \_\_\_\_\_ By \_\_\_\_





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

19

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

2004 ADAAG -**Existing Condition:** 

2007 CBC

1991 ADAAG -

Other 2005 PROWAG-R306 2 **DOJ Location Type:** 

-Classification

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Βv

DBB

Reported By

- Implementation Plan Nbr:

Priority:

**Keynote** 20

Palos Verdes Dr. West & Hawthorne

Location:



Photo # Palos Verdes Dr. West & Hawthorne 20 Blvd.

Field Condition

04.29A - Push Button Height - Height of pedestrian signal push button exceeds

48" max..

Photo #

17

Existing Condition: 49" AFF.

Corrective Action

1991 ADAAG 4.2.5: 4.2.6

**2004 ADAAG** 308.2.1; Fig. 308.2.1; 308.3.1;

Fig. 308.3.1

2007 CBC 1117B 5 9

Other

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Ву

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

Printed 2013-05-09





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Keynote 21

Reporting: 112 of 4367 Rcds



Location: Photo #
Palos Verdes Dr. West & Hawthorne 20

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 8.9%.

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty High

-Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

**Qty ...Of:** 30 SF

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

-Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Classification** 

of By

Keynote 22



Location: Photo #
Palos Verdes Dr. West & Hawthorne 22

Blvd.

Field Condition

**Existing Condition:** 

Corrective Action

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

dicate the WALK interval.

1991 ADAAG -

2004 ADAAG

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306 2

DOJ Location Type: 1

Use: PV Severity: C

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

1 EA

\$2,400

\$0

of By



# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

The state of the s

Reporting: 112 of 4367 Rcds

23

—Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV
Severity: A

Level of Difficulty Moderate

**Corrective Action** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Reported By

**Planned Completion** 

Implementation
Plan Nbr:

Priority:

PV

Moderate

DBB

6/30/2031

Status Not Complete As of 05/09/2013

DBB

6/30/2026

f By

**DOJ Location Type:** 

Level of Difficulty

**Classification** 

Keynote 24

Palos Verdes Dr. West & Hawthorne

Location:



Field Condition

Photo #

22

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

art(s) or pedestrial signal device exceeds o ibs.

Existing Condition: 6 LBF.

Corrective Action

**1991 ADAAG** 4.27.4

2004 ADAAG 309.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC 1117B 6 item 4

**Other** 2005 PROWAG-R306.3.1;

1 EA

\$0

\$0

R405.4

Implementation

Plan Nbr:

Priority:

Use: Severity:

Planned Completion

Status Not Complete As of 05/09/2013

Reported By

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 22 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

eported by

\_\_\_\_\_ By \_\_\_

Location: Photo #
Palos Verdes Dr. West & Hawthorne 22





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

25

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 7.3%.

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty High

-Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments: Relocate curb ramp.

Costs and Funding

**Qty ...Of:** 30 SF

Total Cost \$4.176

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

n Nbr: DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Keynote

Palos Verdes Dr. West & Hawthorne

26

Location:

Field C

25

Photo #

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

2004 ADAAG

1991 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

**Other** 2005 PROWAG-R306.3.3

1 EA

\$0

Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 27 for corrective action.

millents. See Reynote 27 for corrective action

Status Update (check one)

Completed 
In Progress 
Not Complete 
As of

reported by

s of \_\_\_\_\_ By \_\_\_\_



Location: Photo #
Palos Verdes Dr. West & Hawthorne 26



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Moderate

DBB

6/30/2031

Reporting: 112 of 4367 Rcds

27

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity:

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed  $\Box$  In Progress  $\Box$  Not Complete  $\Box$  As of

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

**Planned Completion** 

Level of Difficulty

- Implementation Plan Nbr:

Priority:

**Keynote** 

Palos Verdes Dr. West & Hawthorne

Location:





04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Palos Verdes Dr. West & Hawthorne Blvd.

26

Photo #

26

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0 Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву





#### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

29

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.5%.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

DBB

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

20 SF Qty ...Of:

**Total Cost** \$384

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Priority:

- Implementation Plan Nbr:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

**Keynote** 30

Palos Verdes Dr. West & Hawthorne

Location:

Field Condition

Photo #

29

31

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Photo #

PUSH

BUTTON FOR

Location:

Palos Verdes Dr. West & Hawthorne Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Вν





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

BUTTON FOR

Reporting: 112 of 4367 Rcds

31

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

**Planned Completion** 

Reported By

**Classification** 

- Implementation Plan Nbr:


Priority:

Βv

**Keynote** 32

Palos Verdes Dr. West & Hawthorne

Location:

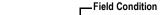

31

Photo #

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.3.3 **DOJ Location Type:** PV Use:

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 31 for corrective action.

Costs and Funding

**Funding Received** 

Qty ...Of: 1EA

**Total Cost** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Ву

Location: Photo # Palos Verdes Dr. West & Hawthorne 31 Blvd.

PUSH

BUTTON FOR

App: ©2010 BOA Architecture 877-225-4ADA

Page 16 of 56



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

PUSH FOR

Reporting: 112 of 4367 Rcds

33

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 35 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

Priority:

- Implementation

**Planned Completion** 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

**Keynote** 34

Vallon Dr. & Hawthorne Blvd.

Location:

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306.2

1 EA

\$2,400

\$0

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Ву

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of



Location: Vallon Dr. & Hawthorne Blvd 33 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Photo #

Photo #

33

App: ©2010 BOA Architecture 877-225-4ADA

Page 17 of 56





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

PV

Moderate

DBB

Status Not Complete As of 05/09/2013

6/30/2031



Reporting: 112 of 4367 Rcds

35

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition: Greater than 5 LBF.

**2004 ADAAG** 309.4

1991 ADAAG 4274

2007 CBC 1117B.6 item 4

Other

2005 PROWAG-R306.3.1;

R405.4

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with compliant vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2.400

Funding Received \$

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Reported By

-Classification

Use:

Severity:

Priority:

**DOJ Location Type:** 

Level of Difficulty

Implementation
Plan Nbr:

\_\_\_\_\_ By \_

**Planned Completion** 

Keynote 36

Vallon Dr. & Hawthorne Blvd.

Location:



Photo #

33

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.5% CS & 7.1% RS.

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty High

Corrective Action — \_\_\_\_\_\_ Costs and F

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

**Qty ...Of:** 30 SF

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

reported by

Location: Photo #
Vallon Dr. & Hawthorne Blvd. 36



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

PV

Moderate

DBB



Reporting: 112 of 4367 Rcds

37

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

**DOJ Location Type:** 

2004 ADAAG 3094 **Existing Condition:** 

Use: Severity:

-Classification

2007 CBC 1117B.6 item 4

Level of Difficulty

2005 PROWAG-R306.3.1: Other

R405.4

- Implementation

Plan Nbr:

Priority:

1 EA Qty ...Of:

Costs and Funding

**Total Cost** 

\$0

**Funding Received** 

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo # Vallon Dr. & Hawthorne Blvd. 37

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Βv

**Classification** 

Use:

**Keynote** 38



04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

**DOJ Location Type:** 

**Existing Condition:** 

2007 CBC

Severity:

Other 2005 PROWAG-R306.2 Level of Difficulty Moderate

PV

DBB

6/30/2031

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0 **Planned Completion** Status Not Complete As of 05/09/2013

Reported By

- Implementation Plan Nbr:

Priority:

Location: Photo #

Status Update (check one) Vallon Dr. & Hawthorne Blvd. 37 Completed □ In Progress □ Not Complete □ As of

Ву





Location:

**Keynote** 

### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

39

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 

Priority:

- Implementation Plan Nbr:

6/30/2026

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

40

Vallon Dr. & Hawthorne Blvd.

Field Condition

Photo #

37

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 7% CS. & 10.2% RS.

1991 ADAAG 4.2.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$576

\$0

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Corrective Action** 

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv

Location: Photo # Vallon Dr. & Hawthorne Blvd 40





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Reporting: 112 of 4367 Rcds

41

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

**Keynote** 

Vallon Dr. & Hawthorne Blvd.

Location:

42

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306.2

**DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty

Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Ву



Location: Photo # Vallon Dr. & Hawthorne Blvd. 41 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Photo #

41

App: ©2010 BOA Architecture 877-225-4ADA

Page 21 of 56

Printed 2013-05-09





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

43

Field Condition

**Existing Condition:** 

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

2004 ADAAG 3094

2007 CBC 1117B.6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

Use: PV Severity: Level of Difficulty Moderate

-Classification

- Implementation Plan Nbr:

Priority:

**DOJ Location Type:** 

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 41 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

6/30/2031 Status Not Complete As of 05/09/2013

DBB

Reported By

**Planned Completion** 

**Keynote** 44

Vallon Dr. & Hawthorne Blvd.

Location:



Field Condition

Photo #

41

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.8% CS & 6.4% RS.

**1991 ADAAG** 4.2.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$576

\$0

**Classification** 

**DOJ Location Type:** 

Βy

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Corrective Action

Location: Photo # Vallon Dr. & Hawthorne Blvd

App: ©2010 BOA Architecture 877-225-4ADA

Page 22 of 56

Printed 2013-05-09





Location:

### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

PUSH BUTTON FOR

Reporting: 112 of 4367 Rcds

45

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

**Classification** 

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

**Keynote** 46

Vallon Dr. & Hawthorne Blvd.

Field Condition

Photo #

45

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

Costs and Funding

**Funding Received** 

2007 CBC

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

Plan Nbr: DBB

Priority:

- Implementation

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Ву

Vallon Dr. & Hawthorne Blvd. 45

Location: Photo #





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

PV

Moderate

DBB

Status Not Complete As of 05/09/2013

6/30/2031

PUSH BUTTON FOR

Reporting: 112 of 4367 Rcds

47

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

**Existing Condition:** 

1991 ADAAG 4.27.4

2004 ADAAG 3094

2007 CBC 1117B.6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 45 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Reported By

-Classification

Use:

Severity:

Priority:

**DOJ Location Type:** 

Level of Difficulty

- Implementation Plan Nbr:

Βv

**Planned Completion** 

**Keynote** 48

Vallon Dr. & Hawthorne Blvd.

Location:



Photo #

45

Field Condition

**Corrective Action** 

Additional Comments:

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 2.3% CS % 12.4% RS.

**1991 ADAAG** 4.2.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$576

\$0

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

DBB Plan Nbr:

Priority:

- Implementation

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Location: Vallon Dr. & Hawthorne Blvd

Photo # 48



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 



Reporting: 112 of 4367 Rcds

49

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments

Existing Condition: Pedestrian signal is not provided.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide vibrotactile and audible signal devices.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$4.800

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$3,984

\$0

**Planned Completion** 

6/30/2031 Status Not Complete As of 05/09/2013

DBB

Βv

Reported By

- Implementation Plan Nbr:

Priority:

**Keynote** 50

Dupree Dr. & Hawthorne Blvd.

Location:



Photo #

49

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

120B - 48" Wide Curb Ramp - Demolish existing concrete curb and slab, and

provide a new concrete curb ramp per ADAAG, CBC, and City/County/State street standards. Curb cut shall be a minimum of 48" wide exclusive of side flares with a

Additional Comments: Provide compliant landing at new vibrotactile signal device.

Comments

**Existing Condition:** 

Corrective Action

slope not exceeding 1:12 along POT.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

-Classification

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Location: Photo # Dupree Dr. & Hawthorne Blvd. 49



Location:

### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Moderate



Reporting: 112 of 4367 Rcds

51

Photo #

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide vibrotactile and audible signal devices.

**Existing Condition:** 

Corrective Action

Field Condition

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other

Qty ...Of:

**Total Cost** 

Costs and Funding

-Classification **DOJ Location Type:** 

Use: PV Severity:

Level of Difficulty

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Classification** 

Status Update (check one)

**Funding Received** 

Completed  $\square$  In Progress  $\square$  Not Complete  $\square$  As of

1 EA

\$4.800

\$0

Βv

51 Dupree Dr. & Hawthorne Blvd.

**Keynote** 52

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.3.3 Other

**DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 54 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$0

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB Priority:

**Planned Completion** 

6/30/2031 Status Not Complete As of 05/09/2013

Ву

Reported By

Location: Photo # 52 Dupree Dr. & Hawthorne Blvd.



# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Reporting: 112 of 4367 Rcds

53

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed  $\Box$  In Progress  $\Box$  Not Complete  $\Box$  As of

Reported By

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

Status Not Complete As of 05/09/2013

6/30/2026

DBB

**Classification** 

-Classification

**Keynote** 54

Dupree Dr. & Hawthorne Blvd.

Location:

Field Condition

Photo #

52

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

Βv

PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

**Existing Condition:** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Ву

Status Not Complete As of 05/09/2013

Reported By

Location: Photo # 52 Dupree Dr. & Hawthorne Blvd.





## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

55

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 6% CS & 8.3% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Hiah

DBB

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

**Total Cost** \$576

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

- Implementation

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βy

Reported By

**Keynote** 56

Dupree Dr. & Hawthorne Blvd.

Location:

Field Condition

55

Photo #

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 6.1% CS &.7.6% RS.

1991 ADAAG 424

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty

Moderate

Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 59 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** 

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv

Location: Photo # Dupree Dr. & Hawthorne Blvd. 56





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

**Keynote** 

57

Reporting: 112 of 4367 Rcds



Location: Photo # 56 Dupree Dr. & Hawthorne Blvd.

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 59 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Βv

**Keynote** 58



Location: Photo # Dupree Dr. & Hawthorne Blvd. 58 Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2

1EA

\$0

\$0

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 59 for corrective action.





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Moderate

Reporting: 112 of 4367 Rcds

59

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

Comments

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other

Costs and Funding

Qty ...Of:

**Total Cost** 

-Classification **DOJ Location Type:** Use: PV Severity:

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

**Funding Received** 

Completed  $\square$  In Progress  $\square$  Not Complete  $\square$  As of

1 EA

\$600

\$0

Βv

56 Dupree Dr. & Hawthorne Blvd.

Photo #

**Keynote** 60

Location:



Location: Dupree Dr. & Hawthorne Blvd.

Photo # 58 Field Condition

Corrective Action

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 59 for corrective action.

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Qty ...Of:

**Total Cost** 

2005 PROWAG-R306.3.3 Other

1 EA

\$0

**Classification** 

**DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Funding Received** Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 



Reporting: 112 of 4367 Rcds

61

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 62 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

**Classification** 

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

**Keynote** 62

Dupree Dr. & Hawthorne Blvd.

Location:

Field Condition

Photo #

61

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

indicate the WALK interval

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Location: Dupree Dr. & Hawthorne Blvd.

Photo # 61





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

**Keynote** 

63

Reporting: 112 of 4367 Rcds



Location: Photo # 61 Dupree Dr. & Hawthorne Blvd.

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Βv

**Keynote** 64



Location: 64 Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 7.9% RS.

1991 ADAAG 4.2.4

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

30 SF

\$576

\$0

Вν

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Photo #

Dupree Dr. & Hawthorne Blvd.





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

65

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 2.2% CS & 5.9% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 68 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

65 Crest Rd & Hawthorne Blvd

Photo #

**Keynote** 66

Location:

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty

Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 68 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Вν





Location:

# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Reporting: 112 of 4367 Rcds

67

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 68 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Βv

Status Not Complete As of 05/09/2013

Reported By

**Keynote** 68

Crest Rd. & Hawthorne Blvd.

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

Comments

Photo #

66

Existing Condition: Path of travel to pedestrian signal device is not provided.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty

Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$600

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

DBB

Plan Nbr: Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Ву

Location: Photo # Crest Rd. & Hawthorne Blvd. 65





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



#### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

69

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 2.2% CS & 11.8% RS

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306.2.1

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty High

DBB

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

**Qty ...Of:** 30 SF

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

Implementation
Plan Nbr:

Priority:

Keynote 70

Crest Rd & Hawthorne Blvd

Location:

Field Condition

Photo #

69

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

**Corrective Action** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

**Qty ...Of**: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

By

Location: Photo #
Crest Rd. & Hawthorne Blvd. 70

PUSH





# City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 112 of 4367 Rcds

71

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

**Other** 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV

Severity: A

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2026

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

Implementation
Plan Nbr:

Priority:

Crest Rd. & Hawthorne Blvd. 70

Photo #

Keynote 72

Location:

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.3.3

DOJ Location Type:

Use: PV Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 70 for corrective action.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

n Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

As of \_\_\_\_\_\_ By \_\_\_\_\_



Location: Photo #
Crest Rd. & Hawthorne Blvd. 70



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

Reporting: 112 of 4367 Rcds

73

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

DBB

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

Crest Rd. & Hawthorne Blvd.

**Keynote** 74

Location:

Field Condition

Photo #

73

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Location: Photo # Crest Rd. & Hawthorne Blvd. 73

App: ©2010 BOA Architecture 877-225-4ADA

Page 37 of 56

Printed 2013-05-09





### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Author: Vaish, B** 

PV

Moderate

**Keynote** 75



Reporting: 112 of 4367 Rcds

Photo # Location: Crest Rd. & Hawthorne Blvd. 75 Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition: 6 LBF.

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1; Other R405.4

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Severity:

Use:

-Classification

**DOJ Location Type:** 

Level of Difficulty

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

**Keynote** 76



Location: Photo # Crest Rd. & Hawthorne Blvd. 76 Field Condition

Corrective Action

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 76 for corrective action.

Comments

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Other

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$600

\$0

Printed 2013-05-09







### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Keynote 77



Reporting: 112 of 4367 Rcds

Location: Photo #
Crest Rd. & Hawthorne Blvd. 76

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

**Other** 2005 PROWAG-R306.2

-Classification

DOJ Location Type: 1

Use: PV

Severity: A

Level of Difficulty Moderate

**Corrective Action** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 76 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

of By

Keynote 78



Location: Photo #
Crest Rd. & Hawthorne Blvd. 75

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2

-Classification

DOJ Location Type:

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 76 for corrective action.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

As of \_\_\_\_\_ By \_\_\_\_







### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

### **Keynote** 79



Reporting: 112 of 4367 Rcds

Photo # Location: 75

**Keynote** 

### Field Condition

Corrective Action

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2" across in one dimension.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 76 for corrective action.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

Costs and Funding

**Funding Received** 

Status Update (check one)

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306 3 3

1 EA

\$0

Completed □ In Progress □ Not Complete □ As of

-Classification

**DOJ Location Type:** 

Use: PV Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Crest Rd. & Hawthorne Blvd.

80

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 5.2% CS & 4.2% RS.

**1991 ADAAG** 4.2.4

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Corrective Action** 

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 76 for corrective action.

Photo # 76

Crest Rd. & Hawthorne Blvd.

Location:

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**


Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

PV

Moderate

DBB

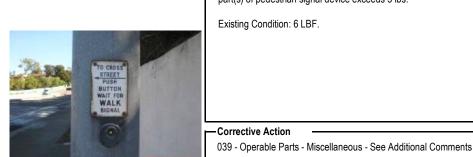

Reporting: 112 of 4367 Rcds

81

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

**DOJ Location Type:** 

2004 ADAAG 309 4 Existing Condition: 6 LBF.

Use: Severity:

-Classification

2007 CBC 1117B.6 item 4

Level of Difficulty

2005 PROWAG-R306.3.1: Other R405.4

- Implementation

Costs and Funding 1 EA Plan Nbr: Priority:

**Total Cost** \$0

**Funding Received** 

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Classification** 

**DOJ Location Type:** 

Location: Photo # Crest Rd. & Hawthorne Blvd.

81

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Use: Severity:

Βv

**Keynote** 82



Field Condition

**Existing Condition:** 

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Additional Comments: See Keynote 83 for corrective action.

1991 ADAAG -

Qty ...Of:

2004 ADAAG -

2005 PROWAG-R306 2

2007 CBC

Level of Difficulty

- Implementation Plan Nbr:

Moderate

DBB

PV

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Qty ...Of:

Other

1 EA

**Total Cost** 

Costs and Funding

\$2,400

\$0

**Planned Completion** 

6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

**Funding Received** 

Completed □ In Progress □ Not Complete □ As of

Priority:

Location: Photo # Crest Rd. & Hawthorne Blvd. 81






**Author: Vaish, B** 

### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Reporting: 112 of 4367 Rcds **Keynote** 83

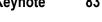



Location: Photo # Crest Rd. & Hawthorne Blvd. 81 Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV

Severity:

Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

**Keynote** 84



Location: Crest Rd. & Hawthorne Blvd. 81 Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

2005 PROWAG-R306 3 3 Other

1 EA

\$0

\$0

**Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 83 for corrective action.

Photo #

App: ©2010 BOA Architecture 877-225-4ADA

Page 42 of 56





### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

**Keynote** 

85

Reporting: 112 of 4367 Rcds



04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 13.4% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Author: Vaish, B

Plan Nbr: DBB

Priority:

- Implementation

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

PV

Moderate

Reported By

**Classification** 

**DOJ Location Type:** 

Corrective Action

Photo #

85

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Qty ...Of:

Costs and Funding

20 SF

**Total Cost** \$384

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Use: Severity:

Βv

**Keynote** 86

Crest Rd & Hawthorne Blvd

Location:



04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition: 6 LBF.

1991 ADAAG 4.27.4

2004 ADAAG 3094

2007 CBC 1117B 6 item 4

Other 2005 PROWAG-R306.3.1:

R405.4

- Implementation

Level of Difficulty

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 90 for corrective action.

Location: Photo #

Crest Rd. & Hawthorne Blvd. 86 Costs and Funding

**Funding Received** 

Qty ...Of: 1 EA

**Total Cost** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □



### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

87

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3

1 EA

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 90 for corrective action.

Qty ...Of:

Costs and Funding

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Keynote** 

Crest Rd. & Hawthorne Blvd.

Location:

88

Photo #

86

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.2 Other

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

6/30/2026

Status Not Complete As of 05/09/2013

Reported By

**Planned Completion** 

Ву

Location: Photo # Crest Rd. & Hawthorne Blvd. 86 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

89

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 5.9% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

**Total Cost** \$576

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

Location: Photo # 89 Crest Rd & Hawthorne Blvd

**Keynote** 90

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306 2

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 

Status Not Complete As of 05/09/2013

Reported By

6/30/2031

Βv



Location: Photo # Crest Rd. & Hawthorne Blvd. 86 Corrective Action

**Existing Condition:** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

1 EA

\$2,400

\$0

App: ©2010 BOA Architecture 877-225-4ADA

Page 45 of 56



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

91

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments

Existing Condition: Path of travel to pedestrian signal device is not provided.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$600

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Classification** 

Reported By

- Implementation Plan Nbr:

**Planned Completion** 

Priority:

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2026

**Keynote** 

Crest Rd. & Hawthorne Blvd.

Location:

92

Photo #

91

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2005 PROWAG-R306.3.3 Other

**DOJ Location Type:** PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

1 EA

\$0

\$0

Location: Photo # Crest Rd. & Hawthorne Blvd. 92 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of





Author: Vaish, B

### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Reporting: 112 of 4367 Rcds



Keynote 93

-Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2

-Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

**Corrective Action** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Costs and Funding

**Qty ...Of:** 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

Implementation
Plan Nbr:

Priority:

ned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Keynote 94

Crest Rd. & Hawthorne Blvd.

Location:



Location: Photo #
Crest Rd. & Hawthorne Blvd. 92

Field Condition

Photo #

92

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

**Other** 2005 PROWAG-R306.2

Classification

DOJ Location Type:

Use: PV

Severity: A

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

.

Printed 2013-05-09





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



Reporting: 112 of 4367 Rcds

95

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.1% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 

Status Not Complete As of 05/09/2013

Βv

Reported By

Use:

- Implementation Plan Nbr:

Priority:

91 Crest Rd & Hawthorne Blvd

Photo #

**Keynote** 96

Location:

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 3 3 **Classification DOJ Location Type:** 

Severity:

Level of Difficulty

Moderate

PV

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 98 for corrective action.

Costs and Funding

**Funding Received** 

Qty ...Of: 1 EA

**Total Cost** \$0

Status Update (check one) Completed □ In Progress □ Not Complete □ As of □

**Planned Completion** Status Not Complete As of 05/09/2013

Reported By

- Implementation Plan Nbr:

Priority:

Βv

Location: Photo # Crest Rd. & Hawthorne Blvd.

96



### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

97

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

**Planned Completion** 6/30/2026

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Location: Photo # Crest Rd. & Hawthorne Blvd. 96

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306.2 **Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Ву





Location: Crest Rd. & Hawthorne Blvd. 96

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Photo #

App: ©2010 BOA Architecture 877-225-4ADA

Page 49 of 56





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B



100

Reporting: 112 of 4367 Rcds

99

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.7% CS & 4.5% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

**Total Cost** \$576

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

**Classification** 

**Keynote** 

Crest Rd. & Hawthorne Blvd.

Location:

Field Condition

Photo #

99

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 3 3 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 102 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

101

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306 2 -Classification

**DOJ Location Type:** 

Use: PV Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

**Funding Received** 

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Βv

Location: Photo # Crest Rd. & Hawthorne Blvd.

100

**Keynote** 102 Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

indicate the WALK interval

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306.2 **Classification** 

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Ву



Location: Photo # Crest Rd. & Hawthorne Blvd. 100 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Page 51 of 56





Location:

### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

103

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.1% CS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

20 SF Qty ...Of:

**Total Cost** \$384

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 

- Implementation Plan Nbr:

Priority:

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

**Classification** 

103

Crest Rd. & Hawthorne Blvd.

**Keynote** 104

PUSH

Field Condition

Photo #

104

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

Qty ...Of:

**Total Cost** 

Other 2005 PROWAG-R306 3 3

**DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Crest Rd. & Hawthorne Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 105 for corrective action.

**Funding Received** Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

1 EA

\$0





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

105

Field Condition

**Existing Condition:** 

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity:

- Implementation

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Reported By

**Classification** 

**Planned Completion** 

Level of Difficulty

Plan Nbr:

Priority:

6/30/2031 Status Not Complete As of 05/09/2013

Moderate

DBB

**Keynote** 106

Crest Rd. & Hawthorne Blvd.

Location:



Photo #

104

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use: Severity:

Level of Difficulty Moderate

Βv

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

Qty ...Of: 1 EA

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

**Planned Completion** 6/30/2026 Status Not Complete As of 05/09/2013

DBB

Reported By

- Implementation Plan Nbr:

Priority:

Ву

Location: Photo # Crest Rd. & Hawthorne Blvd. 104







### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

**Keynote** 

107

Reporting: 112 of 4367 Rcds



Location: Photo # Crest Rd. & Hawthorne Blvd. 107 Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 5.9% CS & 3.8% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Hiah

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

**Total Cost** \$576

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

**Planned Completion** 6/30/2031

Βy

Status Not Complete As of 05/09/2013

Reported By

**Keynote** 108



Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 2.1% CS & 8.1% RS.

1991 ADAAG 424

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$576

\$0

Classification

**DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv



008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Location: Photo # Crest Rd. & Hawthorne Blvd. 108

App: ©2010 BOA Architecture 877-225-4ADA

Page 54 of 56





### City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Photo #

109

Reporting: 112 of 4367 Rcds

109

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 110 for corrective action.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$0

**Funding Received** 

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

Βv

**Planned Completion** 

Reported By

**Classification** 

- Implementation Plan Nbr:

Priority:

**Keynote** 110

Crest Rd. & Hawthorne Blvd.

Location:

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Qty ...Of:

**Total Cost** 

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:** 

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

**Funding Received** 

Completed □ In Progress □ Not Complete □ As of

Location: Photo # Crest Rd. & Hawthorne Blvd. 109 Corrective Action

**Existing Condition:** 

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Status Update (check one)

1 EA

\$2,400

\$0

Ву



## City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



### **Facility Report with Photos**

Facility ID: # Area 5 Pedestrian Signals

Author: Vaish, B

Reporting: 112 of 4367 Rcds

111

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

**Existing Condition:** 

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

**Total Cost** \$2,400

**Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

- Implementation

DBB

Priority:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Crest Rd. & Hawthorne Blvd. 109

**Keynote** 112

Location:

Field Condition

Corrective Action

04.29A - Push Button Height - Height of pedestrian signal push button exceeds

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 10 for corrective action.

48" max..

Photo #

Existing Condition: 49" high.

1991 ADAAG 4.2.5: 4.2.6

**2004 ADAAG** 308.2.1; Fig. 308.2.1; 308.3.1;

Fig. 308.3.1

2007 CBC 1117B 5 9

Other

Costs and Funding

**Funding Received** 

Qty ...Of:

**Total Cost** 

**Classification** 

**DOJ Location Type:** 

PV

Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

Use:

**Planned Completion** 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

BUTTON FOR

Location: Photo # Palos Verdes Dr. West & Hawthorne

Blvd.